

21-033832-121 (PLUG)

Transition Adapter Plug, Differential Twinax,
Type High Speed, Wired
Installation Instructions

See table on reverse side for twinax cable recommended, tool selector settings, crimping tool and positioner information.


- A 1. Cut cable for assembly of transition adapter plug.
- B 1. Strip cable jacket to expose cable outer braid as illustrated. Ends must be cut cleanly and at right angles to the axial plane of the cable. Cable must not be deformed while making cuts.
- C 1. Slide crimp bushing over cable braid until cable jacket butts inside shoulder of crimp bushing as shown.
- D 1. Flair cable outer braid back over crimp bushing as illustrated to expose inner wires. Trim excess cable braid.
- 2. Cut off any inner braids, wraps or cable fillers as close to outer cable braid as possible.
- 3. Cut inner wires to dimension shown. All wire must be cut to equal length.
- E 1. Strip inner wires to expose center conductors as illustrated. All wires must be stripped to equal length.
- F 1. Carefully splay inner wires perpendicular to the axis of the cable as illustrated.
- 2. Assemble inner contact over cable center conductor until fully seated against inner wire insulation. Observe center conductor through the contact's wire inspection hole, to make certain conductor is properly positioned.
- 3. Solder or crimp (using crimp tools listed in table) inner contact to center conductor. Repeat steps F2 and F3 for the remaining inner contact.
- G 1. Position rear insulator against cable braid as illustrated. Make certain insulator slots are aligned with splayed inner contact wires. One-by-one, position wired inner contacts inside the insulator slots as shown. The inner contact's OD undercut must be positioned to capture the insulator's front retention shoulder as illustrated.
- H 1. With inner contacts positioned inside rear insulator slots, assemble front insulator over the inner contacts as shown. The front insulator must butt the rear insulator.

Continued on back

L-2119-CA
April 2015


FSCM77820

21-033832-121 (PLUG)

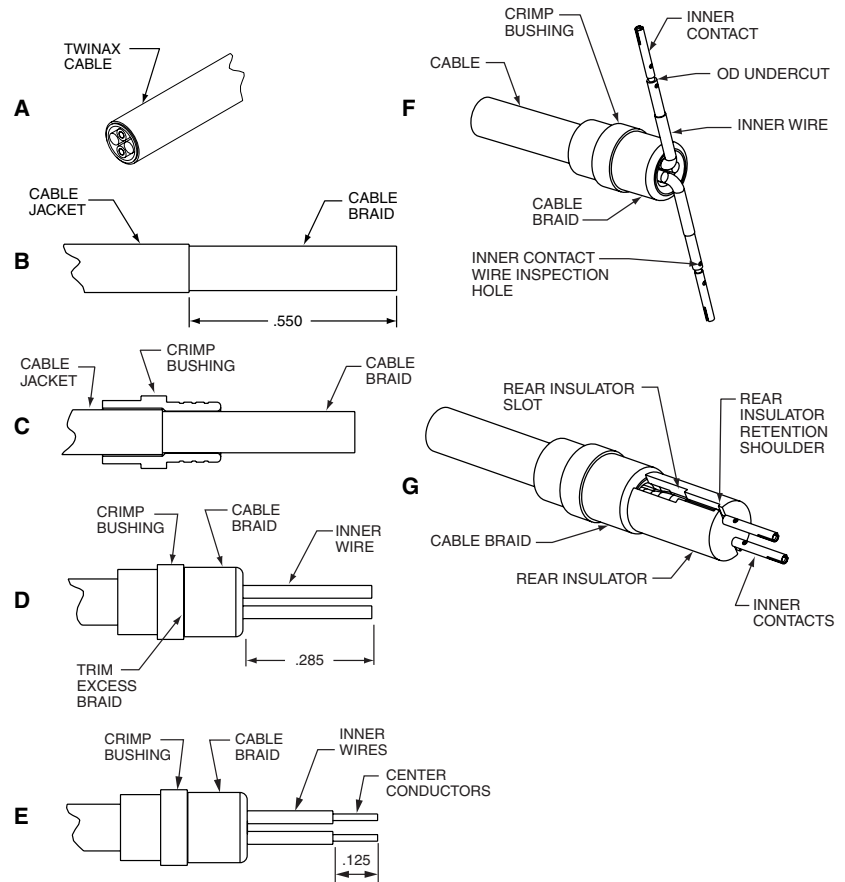

21-033832-121 (PLUG)

- H 2. Observe the front insulator keyway. When the inner assembly is held in the vertical orientation as shown (with inner socket contacts pointed up), the inner pin to the right of the insulator keyway will be positioned at the S1 inner contact position shown in View I.
- I 1. Push the outer contact removal tool fully forward
- 2. Align front insulator keyway with the outer contact's insert orientation rivet key. Slide the inner contact assembly inside the outer contact assembly until fully seated. Observe the mating end of the assembly to make certain rivet key & keyway are engaged and contacts are aligned as shown (ref. 90 degrees).
- 3. Crimp the outer contact body and bushing shoulder in the area indicated using crimp tools listed in table.
- 4. Return outer contact removal tool to initial position.

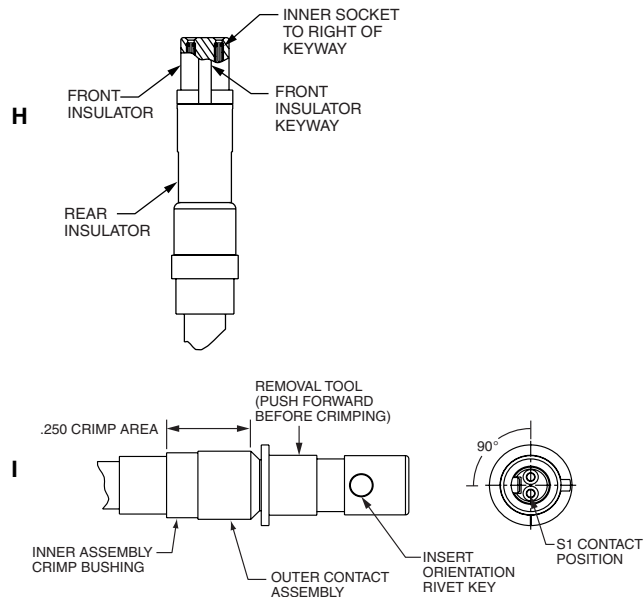

Amphenol Part Number	Description	Twinax Cable Recommended (100 OHM)	Inner Crimp Tools		Outer Crimp Tools	
			Tool (Setting)	Positioner	Tool	Die Set (Location)
21-033832-121	Differential Twinax Transition Adapter Plug (100 Ohm)	Calmont 3007-1923-12-7 or Wescam P01843 or Equivalent	M22520/2-01 (1)	K1745S**	M22520/5-01	M22520/5-05 (B)

** Daniels Manufacturing Corp. Part Number

Amphenol

Amphenol Aerospace
40-60 Delaware Avenue
Sidney, New York 13838-1395
Website: www.amphenol-aerospace.com


21-033832-121 (PLUG)

Transition Adapter Plug, Differential Twinax,
Type High Speed, Wired
Installation Instructions

See table on reverse side for twinax cable recommended, tool selector settings, crimping tool and positioner information.

- A 1. Cut cable for assembly of transition adapter plug.
- B 1. Strip cable jacket to expose cable outer braid as illustrated. Ends must be cut cleanly and at right angles to the axial plane of the cable. Cable must not be deformed while making cuts.
- C 1. Slide crimp bushing over cable braid until cable jacket butts inside shoulder of crimp bushing as shown.
- D 1. Flair cable outer braid back over crimp bushing as illustrated to expose inner wires. Trim excess cable braid.
- 2. Cut off any inner braids, wraps or cable fillers as close to outer cable braid as possible.
- 3. Cut inner wires to dimension shown. All wire must be cut to equal length.
- E 1. Strip inner wires to expose center conductors as illustrated. All wires must be stripped to equal length.
- F 1. Carefully splay inner wires perpendicular to the axis of the cable as illustrated.
- 2. Assemble inner contact over cable center conductor until fully seated against inner wire insulation. Observe center conductor through the contact's wire inspection hole, to make certain conductor is properly positioned.
- 3. Solder or crimp (using crimp tools listed in table) inner contact to center conductor. Repeat steps F2 and F3 for the remaining inner contact.
- G 1. Position rear insulator against cable braid as illustrated. Make certain insulator slots are aligned with splayed inner contact wires. One-by-one, position wired inner contacts inside the insulator slots as shown. The inner contact's OD undercut must be positioned to capture the insulator's front retention shoulder as illustrated.
- H 1. With inner contacts positioned inside rear insulator slots, assemble front insulator over the inner contacts as shown. The front insulator must butt the rear insulator.

21-033832-121 (PLUG)

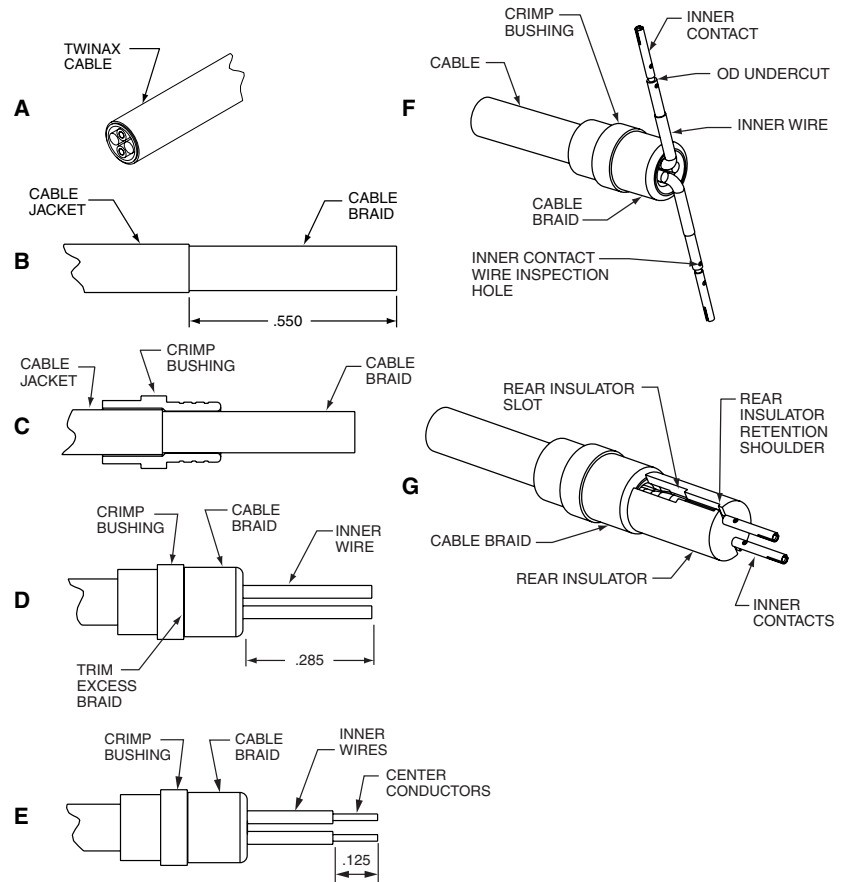

Continued on back

L-2119-CA
April 2015


FSCM77820

Amphenol Aerospace
40-60 Delaware Avenue
Sidney, New York 13838-1395
Website: www.amphenol-aerospace.com

Amphenol

** Daniels Manufacturing Corp. Part Number

Amphenol Part Number	Description	Twinax Cable Recommended (100 Ohm)	Tool (Setting)	Positioner	M22520/5-01	M22520/5-05 (B)
21-033832-121	Differential Twinax Transition Adapter Plug (100 Ohm)	Calmont 3007-1923-12-7 or Wescam P01843 or Equivalent	M22520/2-01 (1)	K1745S**	M22520/5-01	M22520/5-05
		Outer Crimp Tools		Inner Crimp Tools		
		Die Set (Location)				

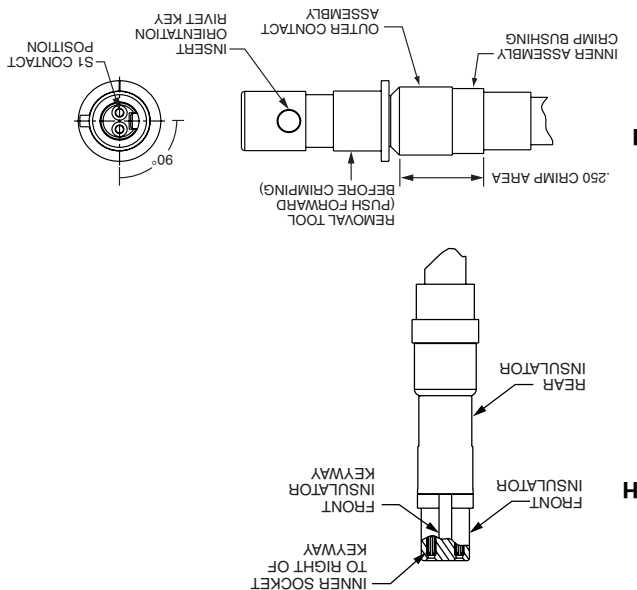

- H 2. Observe the front insulator keyway. When the inner assembly is held in the vertical orientation as shown (with inner contacts pointed up), the inner pin to the right of the insulator keyway will be positioned at the S1 inner contact position shown in View I.
- I 1. Push the outer contact removal tool fully forward.
- 2. Align front insulator keyway with the outer contact's insert orientation rivet key. Slide the inner contact assembly inside the outer contact assembly until fully seated. Observe the mating end of the assembly to make certain rivet key & keyway are engaged and contacts are aligned as shown (ref. 90 degrees).
- 3. Crimp the outer contact body and bushing shoulder in the area indicated using crimp tools listed in table.
- 4. Return outer contact removal tool to initial position.

21-033832-121 (PLUG)